

1078C Series


³/4" Diameter Steel Door with Wire Leads

Installation Instructions

- 1. Drill appropriate diameter and depth holes for contact and magnet. Hole saw arbors available from GE. Holes required except for 1076CD: Holes required for 1076CD:
 - Contact- ³/4" x 1¹/8" Magnet- ³/4" x 1¹/2"

Contact- ³/4" x 1¹/2" Magnet- ³/4" x 1¹/2"

- 2. Connect contact leads to security system loop and test for continuity.
- Lightly coat the contact and magnet with RTV mounting compound (part number 1905) З. and insert into respective holes.

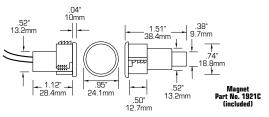

UL Specifications

Part Number	Lоор Туре	Electrical Configuration	Gap Dis In Steel	tance In Wood
1076C	Open or Closed	SPDT	Up to 3/8"	⁷ /8"
1076CW	Open or Closed	SPDT	Up to 3/4"	2"
1076CD (no Canadian listing)	Open or Closed	DPDT	Up to 3/8"	5/8"
1077CW (no Canadian listing)	Open	N/C	Up to 3/4"	2"
1078C	Closed	N/0	Up to 3/8"	7/8"
1078CW	Closed	N/0	Up to ³ /4"	2"

** FORM A (1078, 1078W) Voltage: 100V AC/DC max Current: 0.5A max Power: 7.5W max

FORM B (1077CW) FORM C (1076C, 1076CW) Voltage: 30V AC/DC max Voltage: 30V AC/DC max Current: 0.25A max Current: 0.25A max Power: 3.0W max

Power: 3.0W max

* Gap specifications are nominal and may vary ± 20%. Gap specifications are for switch to make.
** European Union Specifications: 48V AC/DC Max., 0.5 Amp

WARNING: Each electrical rating is an individual maximum and cannot be exceeded!

C-UL Specifications

All Contacts: 30V DC, 50 mA max

Gap Specifications:* See UL Gap Specifications

GE Interlogix

www.GE-Interlogix.com

12345 SW Leveton Drive Tualatin, OR 97062 Phone: 503-692-4052 USA & Canada: 800-547-2556 Technical Service: 800-648-7424 Faxback: 800-483-2495

2266 Second Street North North St. Paul, MN 55109 Phone: 651-777-2690 USA & Canada: 800-777-5484 Technical Service: 800-777-2624

1040682 Rev A 01/03

Made in Taiwan